


Фрезы для снятия фасок

- Пластины, стр. 275
- Режимы резания, стр. 258 - 259

C

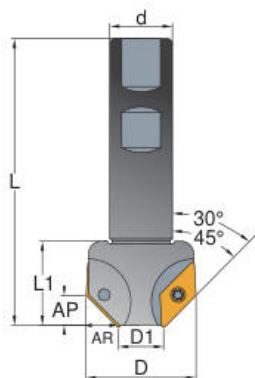

Обозначение	Размеры (мм)							Z	 KG	MAX об/мин	Пластины XDGT	Винт	Ключ
	D	D1	d	L	L1	AP	AR						
C-1124-30°	24	10	20	80	30	10	5	2	0.23	35000	120308	C03506	T10P
C-1633-30°	33	16	25	95	35	14	7.5		0.42	25000	190408	C04008	T15P
C-2260-30°	60	22	32	120	55	33	18.5	3	0.88	8500	400408	C04011	T15P
C-1128-45°	28	10	20	80	30	8	8	2	0.28	35000	120308	C03506	T10P
C-1740-45°	40	17	25	95	35	11	11	3	0.48	25000	190408	C04008	T15P
C-1770-45°	70	17	32	110	50	28	28		0.96	8500	400408	C04011	T15P